

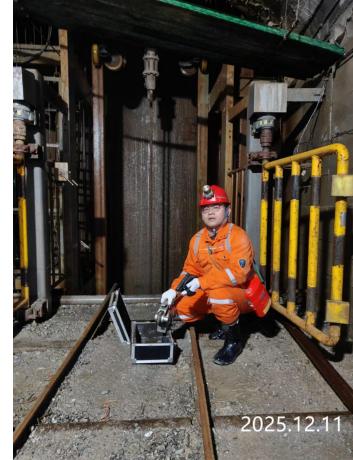
序号	报告编号	发布日期	结论	影像资料
98	GX-B1328/25-1-25161	2025.12.25	本次共检绝缘手套110只，110只绝缘手套合格。	
99	GX-B1328/25-1-25162	2025.12.25	本次共检绝缘靴100只，100只绝缘靴合格。	

100	GX-B1313/21-1-25247~25250	2025.12.26	本次共检电力变压器4台，4台电力变压器所检项目合格		 2025/12/7	
101	GX-B1313/21-1-25251~25253	2025.12.26	本次共检电力变压器3台，3台电力变压器所检项目合格		 2025/12/7	

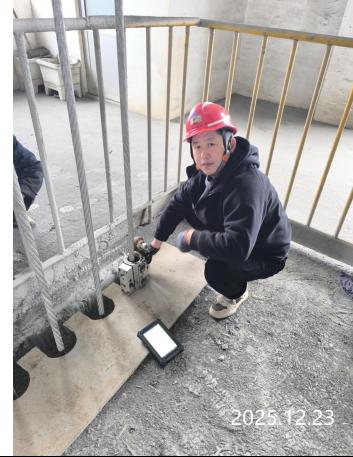
102	GX-B1313/21-1-25254~25258	2025.12.26	本次共检电力变压器5台，5台电力变压器所检项目合格	
103	GX-B1313/21-1-25259~25262	2025.12.26	本次共检电力变压器4台，4台电力变压器所检项目合格	

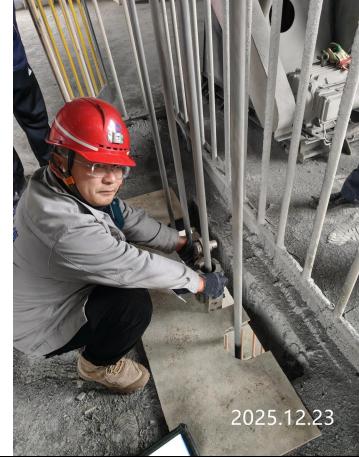
104	GX-B1313/21-1-25263~25264	2025.12.26	本次共检电力变压器2台，2台电力变压器所检项目合格	 2025/12/9
105	GX-B1598/24-1-25110	2025.12.29	实测钢丝绳有效截面积损失百分比最大为1.95%，小于5%为正常	 2025.12.11

106	GX-B1598/24-1-25111	2025.12.29	实测钢丝绳有效截面积损失百分比最大为1.91%，小于5%为正常	 2025.12.11	
107	GX-B1598/24-1-25112	2025.12.29	实测钢丝绳有效截面积损失百分比最大2.09%，小于5%为正常	 2025.12.11	

108	GX-B1598/24-1-25113	2025.12.29	实测钢丝绳有效截面 积损失百分比最大 1.77%，小于5%为正常	 2025.12.11	
109	GX-B1598/24-1-25114	2025.12.29	实测钢丝绳有效截面 积损失百分比最大为 2.32%，小于5%为正常	 2025.12.11	

110	GX-B1598/24-1-25115	2025.12.29	实测钢丝绳有效截面 积损失百分比最大为 2.35%，小于5%为正常	
111	GX-B1332/21-1-25091~25102	2025.12.31	本次共检电力电容器 12台，12台电力电容器 所检项目合格	

112	GX-B1428/21-1-25362	2025.12.29	无缺陷迹痕显示			
113	GX-B1598/24-1-25116	2025.12.31	实测钢丝绳有效截面 积损失百分比最大为 2.33%，小于5%为正常			

114	GX-B1598/24-1-25117	2025.12.31	实测钢丝绳有效截面积损失百分比最大为1.76%，小于5%为正常	 2025.12.23	
115	GX-B1598/24-1-25118	2025.12.31	实测钢丝绳有效截面积损失百分比最大为1.62%，小于5%为正常	 2025.12.23	

116	GX-B1598/24-1-25119	2025.12.31	实测钢丝绳有效截面积损失百分比最大为1.69%，小于5%为正常	 2025.12.23	
117	GX-B1598/24-1-25120	2025.12.31	实测钢丝绳有效截面积损失百分比最大为2.01%，小于5%为正常	 2025.12.24	

118	GX-B1598/24-1-25121	2025.12.31	实测钢丝绳有效截面 积损失百分比最大为 1.92%，小于5%为正常	 2025.12.24	
119	GX-B1598/24-1-25122	2025.12.31	实测钢丝绳有效截面 积损失百分比最大为 2.06%，小于5%为正常	 2025.12.24	

120	GX-B1598/24-1-25123	2025.12.31	实测钢丝绳有效截面 积损失百分比最大为 2.09%，小于5%为正常	 2025.12.24	
-----	---------------------	------------	---	---	--